

## MICROSTRUCTURE OF GaN GROWN ON (111) Si BY MOCVD

D. M. Follstaedt, J. Han, P. Provencio and J. G. Fleming

Sandia National Laboratories, Albuquerque, NM 87185-1056

Cite this article as: MRS Internet J. Nitride Semicond. Res. 4S1, G3.27 (1999)

RECEIVED  
DEC 23 1998  
S T /

## ABSTRACT

Gallium nitride was grown on (111) Si by MOCVD by depositing an AlN buffer at 1080°C and then GaN at 1060°C. The 2.2μm layer cracked along {1-100} planes upon cooling to room temperature, but remained adherent. We were able to examine the microstructure of material between cracks with TEM. The character and arrangement of dislocation are much like those of GaN grown on Al<sub>2</sub>O<sub>3</sub>: ~2/3 pure edge and ~1/3 mixed (edge + screw), arranged in boundaries around domains of GaN that are slightly misoriented with respect to neighboring material. The 30 nm AlN buffer is continuous, indicating that AlN wets the Si, in contrast to GaN on Al<sub>2</sub>O<sub>3</sub>.

## INTRODUCTION

Hexagonal GaN is being widely studied because of its large, direct bandgap and high thermal stability. Applications are envisioned, or are now appearing, in technologies involving short wavelength (green, blue and UV) optoelectronics and high-temperature or high-power electronics. A key materials issue for growth of GaN has been the lack of an ideal substrate, since GaN substrates are not readily available and other semiconductors have large lattice mismatches. Most GaN has been grown on sapphire (Al<sub>2</sub>O<sub>3</sub>); vapor-phase growth usually begins with deposition of a low temperature GaN buffer followed by the complete layer at near 1000°C. Applications with sapphire are limited by its lack of electrical conductivity and high cost.

We have investigated growth of GaN on Si with the intent of integrating short-wavelength devices into Si-based microelectronics, as well as providing an alternative substrate. We have grown GaN by metal-organic chemical vapor deposition (MOCVD) on (111) Si and obtained microstructures much like those for sapphire, but cracking during cooling to room temperature limits our current materials. Here we use transmission electron microscopy (TEM) to examine dislocations in the GaN and the AlN buffer layer used at the interface with the Si substrate, and compare them to corresponding microstructures of GaN grown on Al<sub>2</sub>O<sub>3</sub>. An introduction to this work and our related approaches to growth on Si has been presented [1].

## GROWTH OF GaN

A 1000 rpm rotating disk reactor with 4.75" quartz chamber was used to grow AlN and GaN with trimethylgallium, trimethylaluminum, and ammonia precursors at 30 Torr. Several investigations indicate that growing an AlN buffer first on Si avoids the formation of amorphous Si<sub>3</sub>N<sub>4</sub> since N reacts more exothermically with Al than Si; this is important for attaining good epitaxial growth of GaN [2,3]. Our methods follow those of Watanabe et al [2] who found that AlN buffer growth at >1000°C leads to good epitaxy, in spite of the 17% lattice mismatch of GaN with Si. We grew a 30 nm AlN buffer at 1080°C, followed by 2.2 μm of GaN at 1060°C.

In situ reflectivity in the chamber indicated that the GaN surface was smooth immediately after growth at 1060°C. However, upon cooling to room temperature, a dense set of cracks with

## **DISCLAIMER**

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, make any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

## **DISCLAIMER**

**Portions of this document may be illegible  
in electronic image products. Images are  
produced from the best available original  
document.**

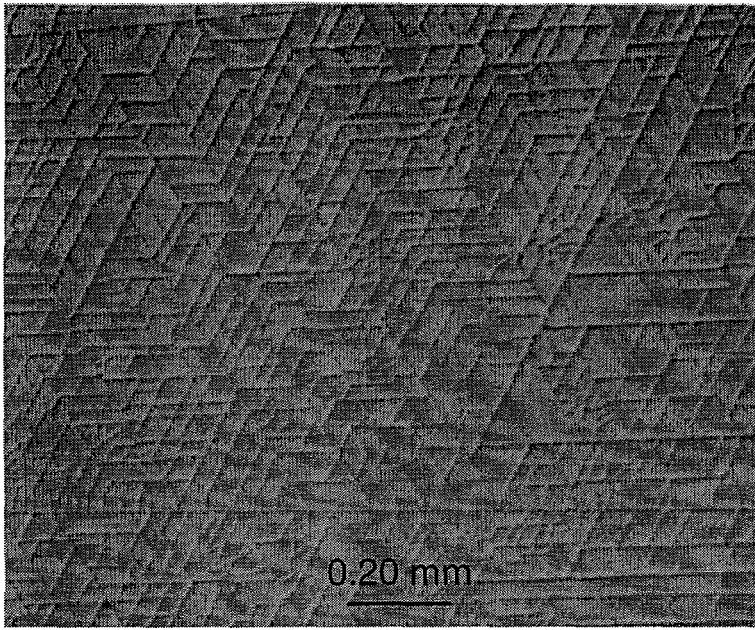


Figure 1. Nomarski optical micrograph showing cracking of GaN on (111) Si along {1-100} planes.

separations from 20 to 100  $\mu\text{m}$  was found along {1-100} planes, as seen in Figure 1. The GaN layer is expected to have relaxed fully at the growth temperature, as found for growth on  $\text{Al}_2\text{O}_3$  using in situ stress monitoring techniques [4]. The greater thermal expansion coefficient of GaN as compared to that of Si ( $5.6 \times 10^{-6}/\text{K}$  vs.  $2.6 \times 10^{-6}/\text{K}$ , respectively) then explains cracking since the GaN layer would be put into tension upon cooling. In spite of cracking, the GaN layer adhered to the substrate. X-ray diffraction of such layers gives (0002) GaN reflections with FWHM of 900 arcsec, similar to those found previously [2].

## TEM CHARACTERIZATION OF DEFECTS IN GaN

Cross-section TEM specimens were successfully prepared by usual metallographic polishing and ion milling methods for both [110] and [1-12] Si orientations in spite of the cracking. Cracks were found passing through the layer and into the Si substrate; the cracks were open with no indication of subsequent deposition, consistent with their forming after growth [1]. The GaN layer was found to be single phase with no 30°-misoriented grains as seen in other material grown by molecular beam epitaxy (MBE) [5]. Selected-area diffraction demonstrated the epitaxial orientation seen previously for GaN on (111) Si [2,3,5]:

(0001) $\parallel$ (111)	interface plane
[1-100] $\parallel$ [11-2]	direction in plane
[11-20] $\parallel$ [1-10]	"

Dislocations thread from the buffer layer to the surface of the GaN layer. Examination in cross-section with different diffracting beams can be used to determine the Burger's vectors of individual dislocations, which for hexagonal close-packed lattices are: **a** (or  $1/3<11-20>$ , in the basal lattice plane), **c** ( $<0001>$ , along the hexagonal axis), or **a+c** ( $1/3<11-23>$ , mixed character). Two diffracting conditions are shown in Figure 2. The upper image (a) uses the (0004) reflection to illuminate the cores of dislocations with Burger's vectors having a c-axis component. The lower image (b) uses a reflection sensitive to those with a basal plane component. Detailed examinations with several reflections indicate that almost all dislocations can be detected in Figure 2b) and have a basal-plane component. Those with the c-axis component seen in Fig. 2a (~1/3 of the total) are almost all of mixed character. The additional ones seen in Fig. 2b (~2/3 of the total) have purely basal-plane Burger's vectors, **b** = **a**; since the dislocation lines are fairly straight along the c-axis growth direction, these are termed edge dislocations. Very few of the dislocations have **b** = **c** corresponding to pure screw dislocations. This distribution of dislocation character is like that found in GaN grown on sapphire [6].

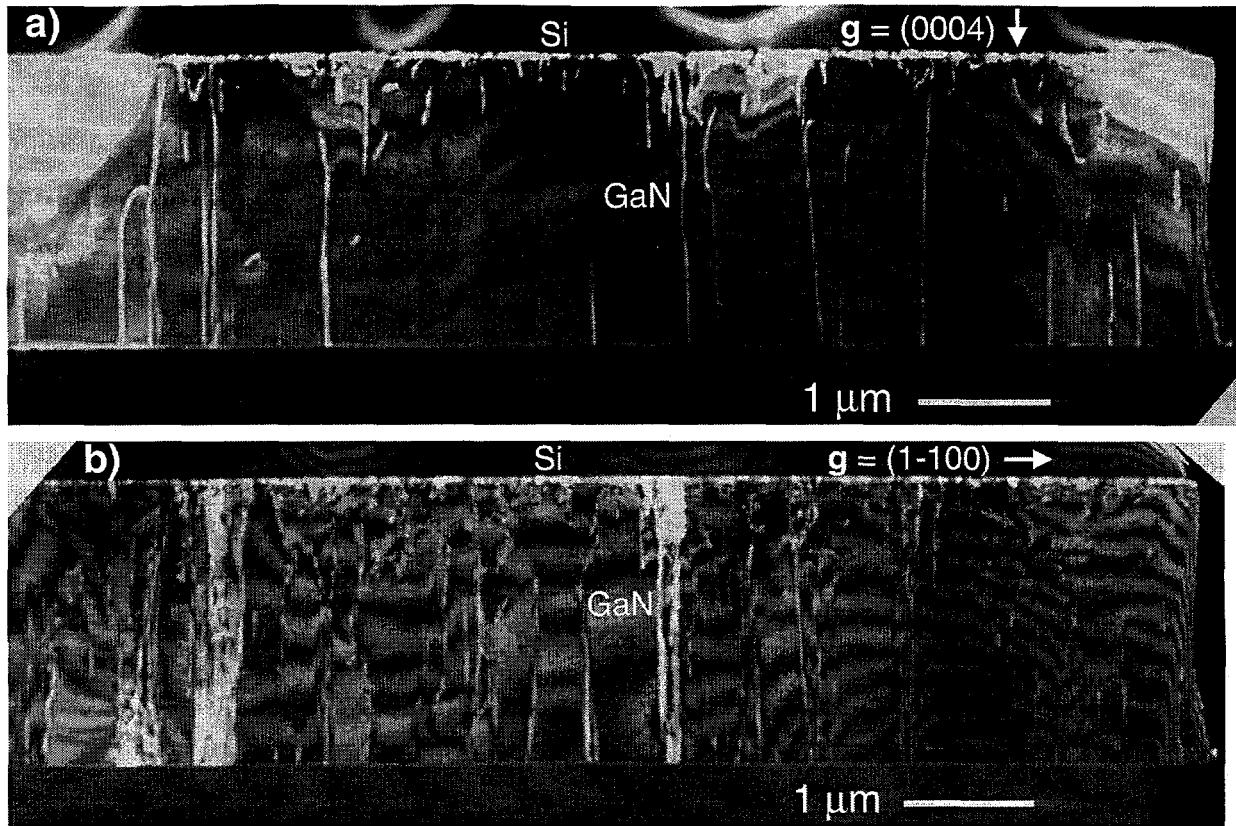


Figure 2. Weak-beam TEM images obtained near [11-20] orientation. a)  $g = (0004)$ , with cores of dislocations having  $\mathbf{b} = \mathbf{a} + \mathbf{c}$  illuminated. b)  $g = (1-100)$ , with cores of all dislocations illuminated. A crack running through the layer and into the Si substrate is seen at far right.

Plan-view TEM gives additional insight into the dislocation arrangement. A specimen was prepared by placing thinned epoxy on the specimen surface to penetrate the cracks, removing excess epoxy from the surface, and carefully backthinning with the specimen attached to a grid for structural support. The thinned area is at the surface of the GaN layer and allows defects threading to it to be detected. In Figure 3, the dislocations are viewed nearly end-on and appear as short black-white segments. They often lie along continuous curves that form boundaries between domains of material with slightly differing orientations. A similar arrangement is found for threading dislocations in GaN grown on sapphire [6]. Plan-view images allow more surface area to be examined than in cross-section and give the most accurate determination of dislocation density at the surface:  $8 \times 10^9$  disl/cm<sup>2</sup> for this specimen. This density is like that found for GaN grown on sapphire, although lower values have been achieved [6].

By examining this greater surface area, an additional defect is found at a low density. Two void-like defects were identified in Figure 3 (small white spots, arrowed) by examining their contrast changes with objective lens focus in the TEM. Such defects have been termed “nanotubes” if they have extended length into the GaN, or “pinholes” if they are pits located at surface [7]. Since we do not have depth information, we cannot determine which of the two classifications apply. Other images taken under high resolution conditions show that the {1-100} lattice planes form facets around the voids. Their areal density is  $\sim 1 \times 10^8$ /cm<sup>2</sup>, again comparable to that found in GaN grown on sapphire [7].

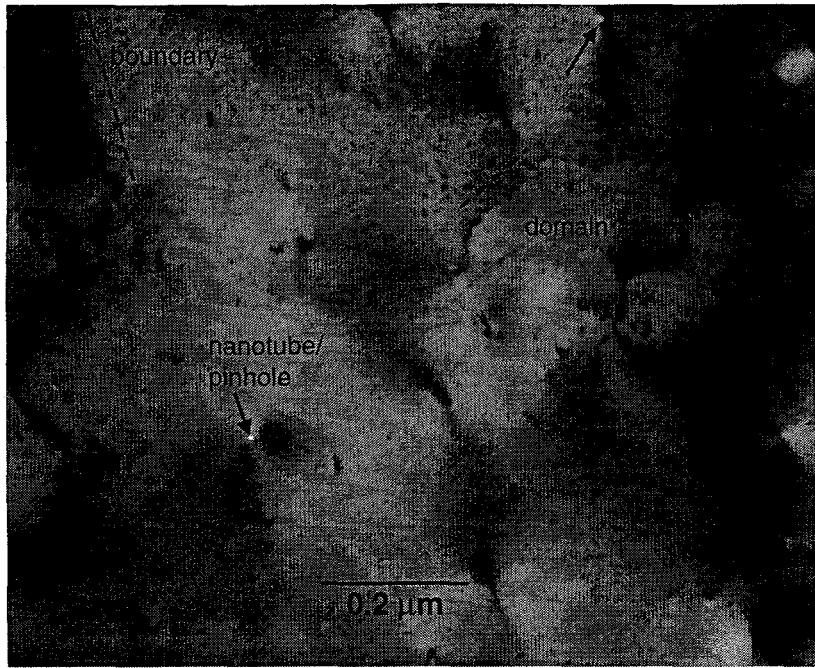


Figure 3. Plan-view TEM image of GaN layer at the surface, obtained near [0001] orientation using  $g = (1-100)$  two-beam conditions in bright-field. Dislocations appear as short black-white segments, and often form continuous curves at boundaries between domains of material with slightly differing orientations; two are noted with nearby dashed lines. Two void-like defects (nanotubes or pinholes) are also noted with arrows.

## EXAMINATION OF AlN BUFFER LAYERS

The buffer layer was found to be continuous over extended distances in cross-section images. Its thickness varies somewhat as seen in Figure 4a, but it is readily identified from the GaN overlayer. By tilting the specimen slightly to vary the contrast in bright field, or by weak-beam examinations like Figure 4b, the layer is seen to be composed of grains 20-40 nm slightly misoriented with respect to each other.

Dislocations in the GaN just above the buffer interact with each other, as seen in Figure 4. The dislocations extend into the AlN buffer at near-normal incidence. In some cases, they appear to coincide with grain boundaries in the buffer; two instances are arrowed in Figure 4b. This suggests that the misorientations between AlN buffer grains may directly produce some of the dislocations threading through the GaN. Perhaps if a buffer layer with larger grains were formed, the GaN would have fewer defects.

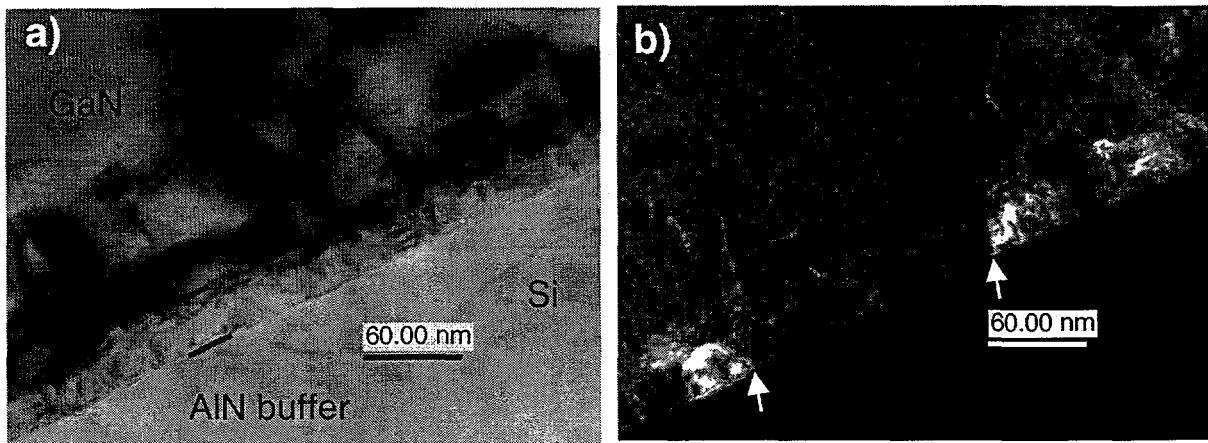


Figure 4. a) Bright-field, (3-300) two-beam image of AlN buffer on Si substrate near [11-20] orientation with dislocations extending into GaN layer above. b) Corresponding weak-beam image showing 20-40 nm grains in the buffer with contrast between them indicating slight orientation differences. Two dislocations appear to originate from grain boundaries in the buffer (arrowed).

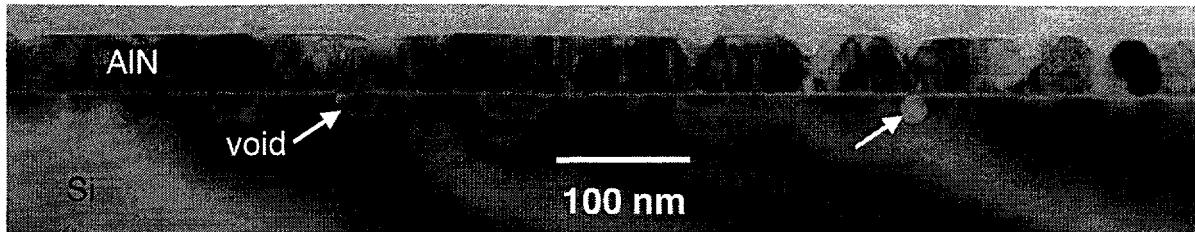


Figure 5. Cross-section TEM image of 40 nm AlN buffer grown on (111) Si, seen in [11-20] orientation with  $g = (0002)$  two-beam conditions. Grains in the AlN buffer are faceted at the top surface, and two voids (arrowed) can be seen just below the interface in the Si.

Having a continuous 30 nm-thick AlN layer on Si implies that the AlN “wets” the Si under our conditions, indicating that the AlN/Si interface has lower energy than the AlN/vacuum surface. A continuous AlN layer was also found for an even thinner (8 nm) buffer grown on Si by MBE [3]. Such continuous layers differ greatly from those observed for GaN grown by MOCVD on  $\text{Al}_2\text{O}_3$  using a low-temperature buffer layer followed by high-temperature growth. For GaN/ $\text{Al}_2\text{O}_3$  the layer must be 0.4  $\mu\text{m}$  thick before it is continuous [6]. The wetting may indicate that more favorable bonding is occurring between nitrides and the Si. Silicon appears to be the preferred substrate for initiating growth of nitrides.

A cross-section TEM specimen was also made of a 40 nm-thick AlN buffer layer grown alone on (111) Si at 1100°C. The layer was again found to be continuous, as seen in Figure 5. Our examinations indicated two other features of this layer. First the individual grains composing the buffer exhibit faceting on the growth surface; the facets appear to be {1-101} lattice planes. Secondly, a few voids were found in the Si immediately beneath the interface, which suggests that Si may be diffusing into the AlN.

## DISCUSSION

Comparisons of microstructural features for GaN grown on Si versus sapphire are summarized in Table I. Cracking clearly remains a problem for the Si substrate that must be overcome before devices can be made. The microstructures of threading dislocations are very similar in GaN grown on the two substrates; it may be possible to influence their density with Si by varying the growth conditions of the AlN buffer. The buffer layers are very different, with AlN wetting Si but GaN not wetting  $\text{Al}_2\text{O}_3$  even after subsequent high-temperature growth; this may reflect a difference in bonding across the interface, although differing deposition temperatures and differences between AlN and GaN need to be considered.

Table I. Comparison of Microstructures: GaN/Al<sub>2</sub>O<sub>3</sub> versus GaN/Si

		<u>GaN/Al<sub>2</sub>O<sub>3</sub></u>	<u>GaN/Si (this work)</u>
<u>Cracking:</u>		no	yes, {1-100} planes
<u>Dislocations:</u>	density	10 <sup>8</sup> – 10 <sup>10</sup> /cm <sup>2</sup>	8x10 <sup>9</sup> /cm <sup>2</sup>
	character	1/3 mixed, 2/3 edge	1/3 mixed, 2/3 edge
	arrangement	domain walls	domain walls
	nanotubes, pinholes	10 <sup>6</sup> – 10 <sup>8</sup> /cm <sup>2</sup>	~10 <sup>8</sup> /cm <sup>2</sup>
<u>Buffer:</u>	type (temperature)	GaN (550°C)	AlN (1080°C)
	wetting	no	yes
	thickness to be continuous	~0.4 μm	~ 30 nm
	microstructure	faulted (hcp/fcc)	hcp grains (20-40 nm)

## ACKNOWLEDGEMENTS

The authors would like to thank S. Hearne and J. Floro for discussions about stress in GaN layers during growth, and S. R. Lee for discussions about cracking in GaN layers on Si. This work at Sandia National Laboratories supported by the United States Department of Energy under Contract DE-AC04-94Al85000. Sandia is a multiprogram laboratory operated by Sandia Corporation, a Lockheed Martin Company for the United States Department of Energy.

## REFERENCES

1. J. Han, J. G. Flemming and D. M. Follstaedt, Mat. Res. Soc. Symp. Proc. 512, 53 (1998).
2. A. Watanabe, T. Takuchi, K. Hirosawa, H. Amano, K. Hiramatsu and I. Akasaki, J. Crystal Growth, 128, 391-396 (1993).
3. S. Guha and N. A. Bojarczuk, Appl. Phys. Lett. 72, 415 (1998).
4. S. Hearne, J. A. Floro and I. Tsong, private communication (in situ stress measurements).
5. S. N. Basu, T. Lei and T. D. Moustakas, J. Mater. Res. 9, 2370 (1994).
6. Dislocations in GaN on sapphire.
7. Z. Liliental-Weber, Y. Chen, S. Ruvimov and J. Washburn, Phys. Rev. Lett. 79, 2835 (1997).