



LAWRENCE
LIVERMORE
NATIONAL
LABORATORY

Over-Pressurized Drums: Their Causes and Mitigation

David Quigley , Fred Simmons, Murty
Kuntamukkula, Janeen Robertson, Samuel Bigger
, David Freshwater, Dina Matz-Seigel

November 4, 2009

Journal of Chemical Health and Safety

Disclaimer

This document was prepared as an account of work sponsored by an agency of the United States government. Neither the United States government nor Lawrence Livermore National Security, LLC, nor any of their employees makes any warranty, expressed or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States government or Lawrence Livermore National Security, LLC. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States government or Lawrence Livermore National Security, LLC, and shall not be used for advertising or product endorsement purposes.

Over-Pressurized Drums: Their Causes and Mitigation

David Quigley, Fred Simmons, Murty Kuntamukkula, Janeen Robertson, Samuel Bigger, David Freshwater, and Dina Matz-Siegel

David Quigley is affiliated with the Y -12 National Security Complex, Oak Ridge, TN, United States; Fred Simmons and Murty Kuntamukkula are affiliated with Savannah River Nuclear Solutions LLC, Aiken, SC, United States; Janeen Robertson is affiliated with Lawrence Livermore Laboratory, Livermore, CA, United States; and Samuel Bigger and David Freshwater are affiliated with the US Department of Energy/ NNSA, Washington DC, United States; Dina Matz-Seigel is affiliated with Los Alamos National Laboratory, Los Alamos, NM.

Abstract

Over-pressurized drums are not uncommon and are potentially dangerous. Drum over-pressurizations may be caused by slow chemical reactions, biological activity, radiolysis, and temperature/pressure changes. Dangers associated with over-pressurized drums range from catastrophic failure at high pressures to the forceful ejection of the lid at lower pressures when an open-top drum is opened. Because of these dangers, it is important to both recognize the symptoms of drum over-pressurization and the best and most safe methods for mitigating over-pressurized drums. In the most severe cases of drum over-pressurization, both the top and bottom of the drum will be distended. In these cases, the safest approach for mitigating the situation is to use a remotely controlled drum punch.

Introduction

Having to contend with bulging or over-pressurized drums is, unfortunately, a common event for people storing chemicals and chemical wastes. The Department of Energy alone reported over 150 incidents of bulging drums between 1992 and 2006 (1, 2). Bulging drums can be caused by many different mechanisms, represent a number of significant hazards and can be difficult to mitigate. In this article, we will discuss the causes, hazard recognition, mitigation, and prevention of drum over-pressurization.

Container Types

Chemicals and chemical wastes may be stored and transported in a wide variety of containers with the drum being the most commonly used industrial container. While pressurization of smaller containers such as cans represents a safety hazard, hazards represented by their pressurization is typically not as significant and, therefore, will not be discussed here. Likewise, glass containers will also not be discussed. It should be noted that while cans and bottles are not formally addressed in this paper, many principles, such as causes of drum pressurization, may apply to these containers as well.

Drums are available in various sizes and types. The most common size drums are 30-gallon, 55 -gallon, and 85 -gallon. The most common types are closed-top and open-top drums. Closed-top drums have the top welded to the top of the drum body and usually have two bungs which can be used to either fill or empty the drum. Open-top drums have lids that are unattached to the drum body, but are held in place with a metal ring called a chime. Closed-top drums are generally used for transporting or storing liquids and open-top drums are used for almost any purpose. A less common third type of drum having a large screw top is typically used as an over-pack container for 55-gallon drums that are damaged or leaking.

Drums may be constructed of many types of materials. Mild steel is the most common construction material, but other materials such as stainless steel, aluminum and nickel may be used for more exotic applications. Plastics, such as high density polyethylene (HDPE), may be used for some drums, especially 85 -gallon drums used for over-packing. Mild steel drums may have an inner plastic liner present as well.

Causes of Drum Pressurizations

Causes of drum pressurizations may be grouped into the following four categories:

1. Chemical Reactions- Whenever chemicals or wastes are collected and/or combined inside a drum, the potential for chemical reactions that generate gases is present. Gas generation may lead to over-pressurization in sealed drums. Three common types of chemical reactions can result in gas generation. One is the oxidation of organic materials. In general, oxidizers will yield carbon dioxide; in the case of nitric acid, the oxidization reaction will yield nitrogen oxides as well as carbon dioxide. A second type of chemical reaction is hydrogen formation by acids reacting with metals including the drum (3). These reactions may occur from a drum constructed of an incompatible material being used to store or transport a chemical or from a leak in a drum liner that would allow the drum's contents to come into contact with the drum itself. A third type of reaction would be decomposition reactions, such as the breakdown of hydrogen peroxide into water, releasing oxygen gas, or of formic acid to yield carbon dioxide. In general, higher temperatures (such as when a drum is left exposed to direct sunlight) tend to accelerate the rates of chemical reactions resulting in higher gas generation rates and leading to more rapid buildup of drum pressure.
2. Biological Activity- Wastes, sludges and other materials may contain microorganisms that are metabolically active. When these microbes are present in a sealed drum, they can produce carbon dioxide, methane, or other gases, which can raise the pressure inside the drum. It should be noted that even material that appears dry (leaves, dead branches, wood shavings, etc.) still have enough residual water present to allow for microbial activity.
3. Radiolysis- Drums containing radioactive material along with organics or water (e.g., transuranic waste or mixed waste) can have radiolysis reactions occur inside them. In this situation, radioactive decay produces high energy

radiation that can result in the formation of hydrogen and other gases from the breakdown of the water or organic material (4). The generation of these gases leads to the increased pressure inside the drum.

4. Temperature and Pressure Changes- Changing the physical environment can result in increased pressures. Moving a sealed drum from a cool environment into a much warmer one and/or placing a dark colored drum in direct sunlight can result in the pressure increasing from heated, expanding gases. The effect can be exaggerated if a relatively low boiling solvent is present inside the drum and the increased temperature, due to radiant heat absorption, results in an increased vapor pressure of the solvent (5). Likewise, moving a sealed drum from sea level to a higher altitude can result in a modest pressure increase.



Figure 1. Severely over-pressurized closed-top drum. Note how the bottom is bulging.
Source: Y-12 National Security Complex



Figure 2. Bulging lid of an over-pressurized closed-top steel drum containing wastewater. Adjacent 3 drums on the pallet are not bulging. (3) Source: Savannah River Site

Dangers of Drum Over-Pressurization

There are three potential safety issues associated with over-pressurized drums. The first is the amount of energy stored within a pressurized open-top drum. Relatively small increases in internal pressures can represent a significant hazard. Open-top, 55 -gallon drums provide a good example of why this is the case. The typical 55 -gallon drum lid has a diameter of 22 inches which means the surface area of the lid is approximately 380 inches squared. Because there is such a large surface area, a relatively small pressure increase can result in a large outward force being exerted on the lid. This being the case, a 2 pounds per square inch (psi) greater pressure on the inside of a 55 -gallon drum as compared to the outside would result in approximately 760 pounds of upward force being exerted upon the lid (4). If this amount of pressure was present in an open-top drum and the chime removed, then the lid, which weighs approximately 2 pounds, could be released with enough force to send the lid approximately 4 feet into the air (Table 1). Such an event has the potential to maim or kill the person removing the chime.

Drum Internal Pressure (psig)	Approximate Drum Lid Response, Vertical Height (feet)	Initial Upward Force (lbf)
1	2	380
2	4	760
4	8	1521
6	10	2281
8	12	3041
10	15	3801
12	20	4562
14	>20	5322
>14	Typically self-venting	

Table 1. Drum Lid Response when Released from an Open-top 55 -Gallon Mild Steel Drum (3)

A second potential safety issue concerns drum failure. Greater internal pressures can cause drums to fail. Pressures required for the drum to fail and the mechanism of failure vary and are dependent upon the size and type of drum as well as the material of construction. Both open-top and closed-top 30 -gallon metal drums tend to fail catastrophically at internal pressures greater than 14 psi gauge (psig) and 120 psig respectively. Open-top, 55 -gallon metal drums tend to fail where the lid is connected to the drum body. Drum failure has been reported at as low a pressure as 14 psig, but some drums do not fail until pressures as high as 30 psig are attained. Sometimes this failure is characterized by a venting process on the chime and other times by releasing the lid with great force. This force can be large enough to throw the lid several hundred feet. Closed-top, 55 -gallon metal drums all fail at either the top or the bottom with twice as many failing at the bottom. When a closed-top drum fails at the bottom, it turns the

drum into a projectile. Failure at the bottom of the drum becomes more violent as the volume of the liquid inside the drum increases. All closed-top 55 -gallon metal drum failures occur below 48 psig (4), but HDPE drums can sometimes withstand greater internal pressures prior to failure. Unlike 55 -gallon metal drums, it is common for the 55-gallon HDPE drums to fail through the side seam. 85 -gallon overpack drums typically fail by venting through the screw top at pressures of 16 psig or less.

A third safety issue involves the drum's contents. While it is obvious that drum failure will lead to the violent release of the drum contents, it is less obvious that the ejection of an open-top drum lid will likewise cause the drum's contents to be released. Releases may result in employee exposures, environmental contamination, and, in the case of flammable gases and liquids, a potential fire situation.

Symptoms and Measurements of Drum Pressurization

Bulging at the top or bottom of drums is typically the first indication that a drum is pressurized. (Figures 1 and 2) Using this method for determining pressurizations for less than 4 psi is difficult. Some drums may have an increased pressure of 2 psi and show no visible or audible signs of over-pressurization; yet this amount of pressure is enough to cause harm should the lid be released. Because of differences in physical properties, stainless steel drums may not show as much bulging as mild steel drums at identical internal drum pressures. Also, smaller size 30 -gallon drums may not distend as much as the larger size 55 -gallon drums. Other drums may have a small bulge in the lid, but that bulge may be due to mechanical handling issues and represents no internal over-pressurization. Because of this, making determinations as to whether a drum is over-pressurized or not based upon the distension of the lid becomes problematic. Significant bulging of the lid of a 55 -gallon steel drum typically does not become apparent until the pressure inside the drum exceeds 4 psi. This is important because a significant danger could be present at a few psi and the drum would show no overt physical signs of pressurization. As the pressure increases, the bottom bulging becomes more pronounced giving the drum a teetering appearance. At this point, both the top and bottom of the drum are distended causing the drum to become shaped like an egg standing on end. As the pressure increases even more, pinging will be heard. This pinging sound becomes more pronounced as the drum comes closer to failure. Any drum that is bulging on both the top and bottom and/or is making a pinging noise should be treated as an imminent hazard; appropriate emergency actions should be taken such as evacuation of personnel from the area.

There are not many tests that can be performed to determine the pressure inside a drum. One test that many perform is the "flex" test. **The "flex test" should never be attempted.** If one cannot depress the bulging lid with the palm of the hand, then the internal pressure is likely above 6 psi. Attempting this test can result in the lid being violently ejected from the drum resulting in injury or death to the worker. Recently, efforts have been made to use the "Kettledrum" effect to measure internal pressures (6). If one views the drum lid in the same manner as a kettledrum membrane, then one can understand how an increasing pressure inside the drum would place more strain on the drum lid which would

in turn change its resonance frequency when “thumped”. Using this concept, attempts have been made to correlate the resonating frequency of the drum lid with pressures inside the drum.

Mitigating Pressurized Drums

Many methods have been developed to mitigate over-pressurized drums. Methods used are:

1. Uncontrolled Penetration- Early on, the preferred method of mitigating over-pressurized drums was to kinetically puncture them using either a bow and arrow or a bullet. However, there are many reasons why this method is no longer favored. First, in many instances, the drum must be moved from its current location to a safe (remote) area and moving a potentially unstable drum is not an intrinsically safe activity. Second, using an uncontrolled method for breaching the drum can result in the drum failing explosively, with parts of the drum being thrown over large distances. Lastly, the uncontrolled breaching of the drum can result in the drum’s contents spilling onto the ground requiring subsequent remedial clean-up activity. If the drum comes apart violently, then this clean-up activity becomes more complex and expensive.
2. Drum Web (7) - A device called a drum web can be used during the breaching of open-top drums. A drum web is webbing that is affixed to the drum. It covers the top of the drum and is held in place by cinching the web to the side of the drum. Once in place, the bolt holding the chime in place can be loosened. Upon loosening the chime, pressure will either be released by slowly venting around the rim or the lid will be violently ejected. If the lid is violently ejected, then the drum web will catch the lid and prevent it from causing damage. One difficulty associated with using the drum web involves how the chime is to be loosened. If the chime is manually loosened, then the worker must be sure to stay away from the lid lest it be forcefully ejected off the top of the drum. This issue can be resolved by using a remote device to loosen the chime. Another issue would concern the potential ejection of the drum’s contents should the lid be forcefully removed. Ejected contents would potentially result in contamination of the ground and nearby workers. A third issue is that the over-pressurized drum may be required to be moved from its original location in order to place the web on the drum. Lastly, if a drum web is used to control the violent release of a drum lid, then the violence of the lid releasing event may cause adjacent drums, which may also be in a state of overpressurization, to become destabilized.
3. Controlled Penetration- The preferred method for venting drums is to use a controlled penetration technique. (Figure 3) If the over-pressurized drum is closed-top, then the bung can be slowly loosened. Once the bung is loosened, the drum will start to vent. This venting occurs long before the bung can be completely unscrewed. For open-top drums, the preferred method is to use a

drum punch. In this process, a device is placed over the top of the drum that serves as the puncturing platform and also holds the drum in place. A hydraulic punching device with a non-sparking tip is then driven into the lid and the pressure released.

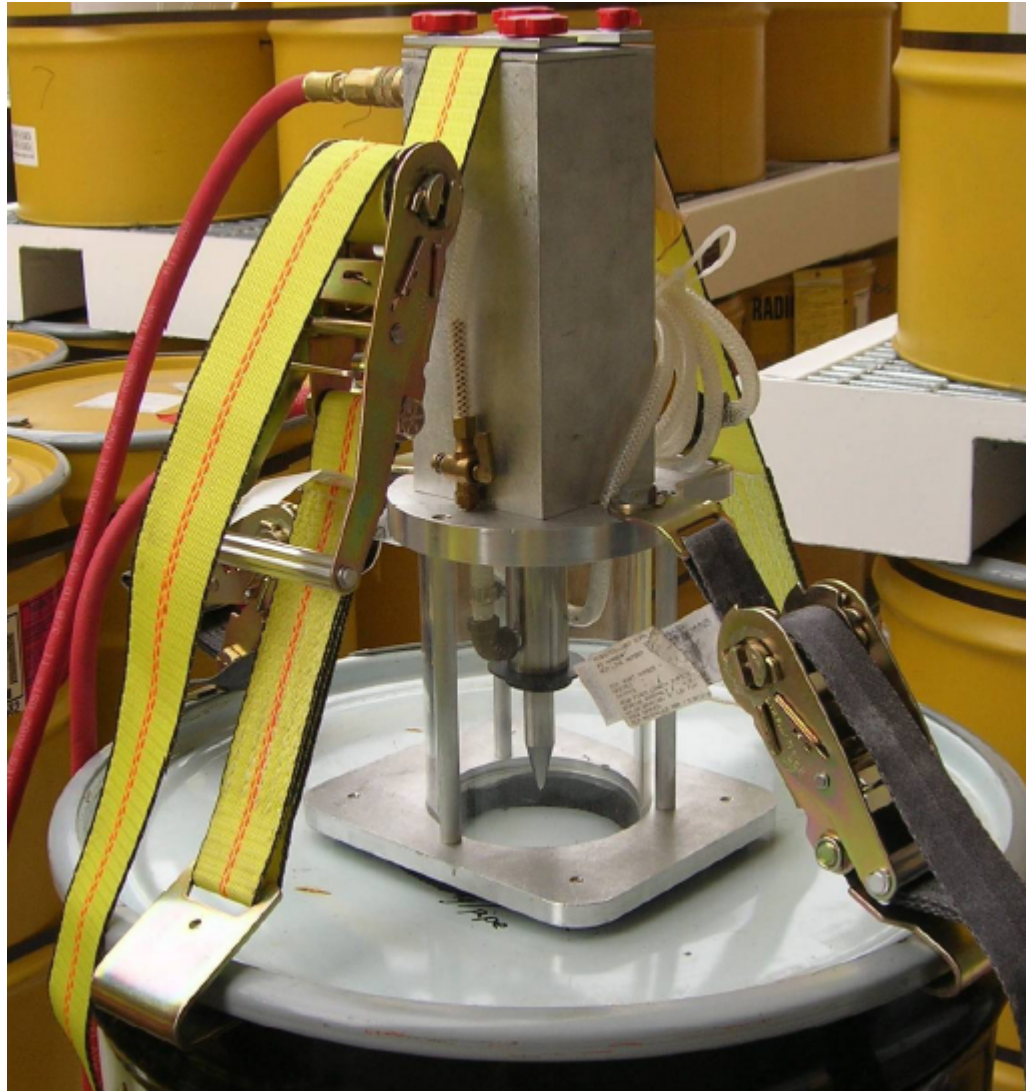


Figure 3. Controlled penetration device. Source: Los Alamos National Laboratory

Preventing Drum Over-Pressurizations

There are several steps that can be taken to help insure against drum over-pressurizations. The first is to know what materials are being placed into the drums and ensure they will not undergo any type of gas or heat generating reaction. The second step is to store the drum in a controlled temperature environment and out of direct sunlight. This will prevent the expansion of gases from the drum due to radiant heating which can lead to pressurization. Lastly, if the potential for pressurization is known and if the drum lid is configured to accept one, then a pressure relief device should be used. These devices are

available with pressure ratings as low as 1 or 2 psig. If these devices are used, then it is important to get the correct type of venting device. For example, if repeated venting may occur, then a rupture disc would not be appropriate.

Conclusions

Drum pressurization can represent a significant safety hazard. Unless recognized and properly mitigated, improperly manipulated pressurized drums can result in employee exposure, employee injury, and environmental contamination. Therefore, recognition of when a drum is pressurized and knowledge of pressurized drum mitigation techniques is essential.

Prepared by LLNL under Contract DE-AC52-07NA27344.

References

1. Larranaga, M. D.; Volz, D. L.; Bolton, F. N.; *Pressure Effects on and Deformation of Waste Containers*. Fire Engineering. 1999. 152(7), 55 -64.
2. Department of Energy, Environment, Safety and Health Bulletin DOE/EH -0697. *Gas Buildup in Drums*. July 2006.
3. Vormelker, P. R.; Guy, J. C.; *Failure Analysis: Wastewater Drum Bulging*. J. Fail. Anal. And Preven. 2009. 9:127 -132
4. Williams, M., and Sferrazza, L. *Pressurized Drums, What Every Handler Should Know*. Department of Defense Radioactive Waste Generators Conference. May, 2002. http://www.eetcorp.com/products/press_drum.pdf June 2009
5. Department of Energy, Office of Nuclear and Facility Safety. *Fire, Explosion, and High-Pressure Hazards Associated with Waste Drums and Containers*. Issue No. 93-01. 1993.
6. Costley, R. D., Henderson, M. E., Patel, H., Jones, E. W., Boudreaux, G. M., and Plodinec, M. J. *The Measurement of Pressure and Level of Fill in Sealed Storage Drums*. NDT&E International. 2006. 40(4): 300 -308.
7. <http://www.eetcorp.com/products/drumweb/drumweb.pdf> June 2009